
HPS9999 09-08

ME-0739-PS-433-B

D-M-E

INSTALLATION DATA
FOR HP-SERIES STRAIGHT SHOTS
PLEASE READ CAREFULLY BEFORE INSTALLING COMPONENTS

HP-Series Straight Shot "S" Type

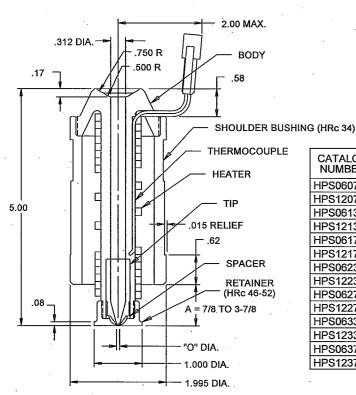

CATALOG NUMBER	"O" DIA.	SHOULDER LENGTH A
HPS0607S2	0.062	7/8
HPS1207S2	0.125	170
HPS0613S2	0.062	1-3/8
HPS1213S2	0.125	1-3/6
HPS0617S2	0.062	1-7/8
HPS1217S2	0.125	1-770
HPS0623S2	0.062	2-3/8
HPS1223S2	0.125	2-3/0
HPS0627S2	0.062	2-7/8
HPS1227S2	0.125	2-110
HPS0633S2	0.062	2 2/0
HPS1233S2	0.125	3-3/8
HPS0637S2	0.062	2.7/0
HPS1237S2	0.125	3-7/8


REPLACEMENT PARTS NOTE: DIMENSIONS ARE IN INCHES

ASSEMBLY CAT. NO.	BODY CAT. NO.	SHOULDER BUSHING CAT. NO.	TIP CAT. NO.	RETAINER CAT. NO.	SPACER CAT. NO.	HEATER CAT. NO.	THERMOCOUPLE CAT. NO.
HPS0607S2		HPS1007	HPT0001	HPT0601	HPT1001	HPS2001	HPTS3001
HPS0613S2	HPS0001	HPS1013					
HPS0617S2		HPS1017					
HPS0623S2		HPS1023					
HPS0627S2		HPS1027 HPS1033					
HPS0633S2	,						
HPS0637S2		HPS1037					
HPS1207S2		HPS1007	HPT0002	HPT1201	HPT1001	HPS2001	HPTS3001
HPS1213S2		HPS1013					
HPS1217S2		HPS1017					
HPS1223S2	HPS0001	HPS1023					
HPS1227S2		HPS1027					
HPS1233S2	·	HPS1033					
HPS1237S2		HPS1037					

D-M-E SHALL NOT BE LIABLE FOR MISUSE OR FAILURE TO FOLLOW THE ENCLOSED INSTRUCTIONS AND SPECIFICATIONS. D-M-E HERBY TO DISCLAIMS ALL IMPLIED WARRANTIES, INCLUDING MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. IN NO EVENT SHALL D-M-E BE RESPONSIBLE FOR LOSS OF USE, REVENUE OR PROFIT, OR FOR INCIDENTAL OR CONSEQUENTIAL DAMAGED.

HP-Series Straight Shot "E" Type


("E" TYPE RETAINER MUST BE MODIFIED)

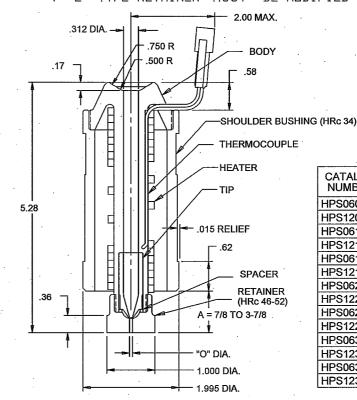

CATALOG NUMBER	"O" DIA.	SHOULDER LENGTH A	
HPS0607E2	0.062	7/8	
HPS1207E2	0.125	778	
HPS0613E2	0.062	1-3/8	
HPS1213E2	0.125	1-3/0	
HPS0617E2	0.062	1-7/8	
HPS1217E2	0.125	1-776	
HPS0623E2	0.062	2-3/8	
HPS1223E2	0.125	2-3/0	
HPS0627E2	0.062	2-7/8	
HPS1227E2	0.125	2-110	
HPS0633E2	0.062	3-3/8	
HPS1233E2	0.125		
HPS0637E2	0.062	3-7/8	
HPS1237E2	0.125	3-116	

REPLACEMENT PARTS

- 1								
	ASSEMBLY CAT. NO.	BODY CAT. NO.	SHOULDER BUSHING CAT. NO.	TIP CAT. NO.	RETAINER CAT. NO.	SPACER CAT. NO.	HEATER CAT. NO.	THERMOCOUPLE CAT. NO.
1	HPS0607E2		HPS2007	НРТ0001	HPT0602	HPT1001	HPS2001	HPTS3001
1	HPS0613E2		HPS2013					
۱	HPS0617E2		HPS2017					
1	HPS0623E2	HPS0001	HPS2023					
1	HPS0627E2]	HPS2027					
1	HPS0633E2		- HPS2033					
1	HPS0637E2		HPS2037					
1	HPS1207E2		HPS2007	HPT0002	HPT1202	HPT1001	HPS2001	HPTS3001
1	HPS1213E2		HPS2013					
1	HPS1217E2		HPS2017					
1	HPS1223E2	HPS0001	HPS2023					
1	HPS1227E2	E2	HPS2027					
1	HPS1233E2		HPS2033					
1	HPS1237E2		HPS2037					

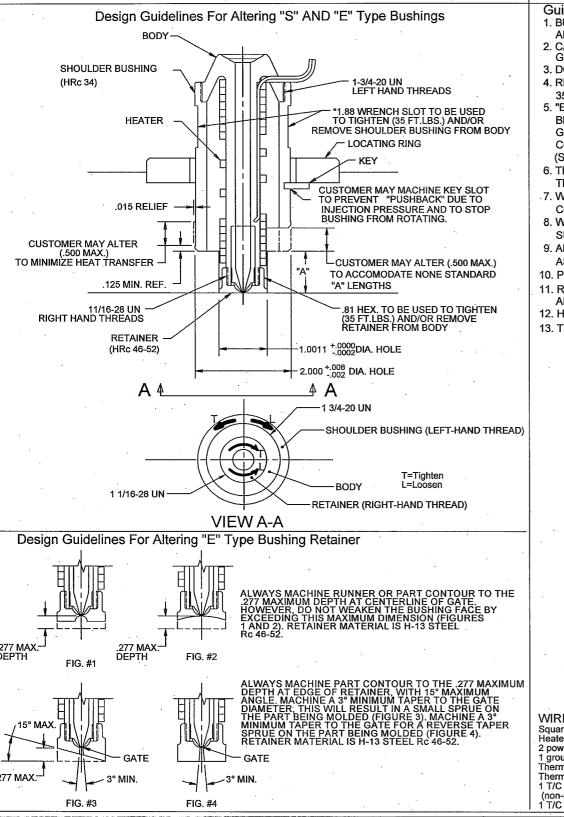

Guidelines And Recommendations:

1. BUSHING BODY SHOULD BE CLEANED OF ANY MATERIAL IN SPH. RAD. AND THREADED AREAS BEFORE REASSEMBLING. SHOULDER BUSHING THREAD IS "LEFT-HAND".

2. CAUTION ATTENTION SHOULD BE TAKEN NOT TO DAMAGE TIP. TREAT TIP LIKE A GLASS OR CERAMIC MATERIAL

3. DO NOT LURICATE OR USE ANTI-SEIZE ON THREADS.

4. RETAINER MUST BE TORQUED ONTO THE BUSHING BODY USING A TORQUE WRENCH AT 35 FT-LBS (RETAINER HAS A .81 HEX.). RETAINER THREAD IS "RIGHT-HAND".

5. "E" TYPE RETAINER MUST BE MODIFIED AND SHOULD BE REMOVED FROM THE BODY BEFORE MACHINING RUNNER OR PART CONTOUR INTO RETAINER. SEE DESIGN GUIDELINES FOR ALTERING "E" TYPE BUSHING RETAINER. WHEN MACHINING IS COMPLETE, REASSEMBLE RETAINER ONTO BUSHING BODY USING SPECIFIED TORQUE (SEE NOTE #4).

6. THE THERMAL EXPANSION FACTOR SHOULD BE CONSIDERED PROIR TO ASSEMBLING THE BUSHING INTO THE MOLD.

7. WHEN HANDLING BUSHING, USE CAUTION AS TO NOT DAMAGE HEATER AND THERMO-COUPLE LEADS

8. WAIT A MINIMUM OF 5 MINUTES AFTER SET POINT HAS BEEN ACHIEVED FOR SUFFICIENT HEAT TO TRANSFER INTO THE TIP BEFORE MOLDING.

9. ALWAYS USE A CLOSED LOOP HEATER ON THE MACHINE NOZZLE TIP AND PLACE AS CLOSE TO THE BUSHING RADIUS END AS POSSIBLE.

10. PROVIDE MAXIMUM WATER COOLING IN THE "A" PLATE AND/OR CAVITY INSERT

11. ROUTE WIRES THROUGH MACHINE PLATEN AND TO DME CONTROLLER. AROUND GATE.

12. HEATER IS 700 WATTS / 240 VOLTS AND LEADS ARE 5 DEG FROM CENTERLINE.

13. THERMOCOOPLE IS 5 DEG FROM CENTERLINE.

IMPORTANT SAFETY INFORMATION

A hot-runner system includes electrical elements and may contain molten plastic at elevated temperature and pressure. To avoid injury, exercise caution by reading these instructions before servicing or operating the

These instructions must be passed on to the end user where they should be read before using this product. Failure to do so can result in serious injury or death.

∕!\ DANGER

Failure to comply will result in serious injury or death: ELECTRICAL HAZARDS

Improper voltages or grounding can result in electrical shock. Use only

with proper voltage and a proper earth ground.

To avoid electrical shock, do not operate product when wet.

Do not operate this equipment with covers or panels removed.

To avoid electrical shock, turn off main power disconnect and lockout /

tag out before servicing this device. Do not connect temperature sensors to electrical power. It will damage the product and it can cause fire, severe injuries or even death.

If green ground wire present wire must be connected to the ground.

Do not rebend rigid leads. Rebending leads might result in damage to circuit. Product might absorb moisture when cool. Use low Voltage or power to drive out residual moisture before applying full power. Failure to do so may cause damage to this product.

WARNING

Failure to comply can result in serious injury or death: STORED ENERGY AND HIGH TEMPERATURE HAZARDS This product maintains molten plastic at high pressure. Use caution when operating and servicing the system.

Physical contact with molten plastic may result in severe burns. Proper protective equipment, including eye protection, must be worn. This product has heated surfaces. Use caution when operating and servicing the system to avoid severe burns. Proper protective equipment should be worn.

WIRING INFORMATION

Square Coil Heaters are supplied with 50" long leads, 24 gage. Heaters are 240 VAC.

2 power leads are BLACK or MULTI COLOR 1 ground lead is GREEN, 24 Gage.

Thermocouples are "J" Type.

Thermocouples are supplied with:

1 T/C lead is WHITE and negative (-) constantan

(non-magnetic).

1 T/C lead is BLACK and positive (+) iron (magnetic).

D-M-E COMPANY

29111 STEPHENSON HIGHWAY MADISON HEIGHTS MICHIGAN 48071 USA US 800-656-6656 CANADA 800-387-6600 www. dme. net